


# Well W#3492 Information

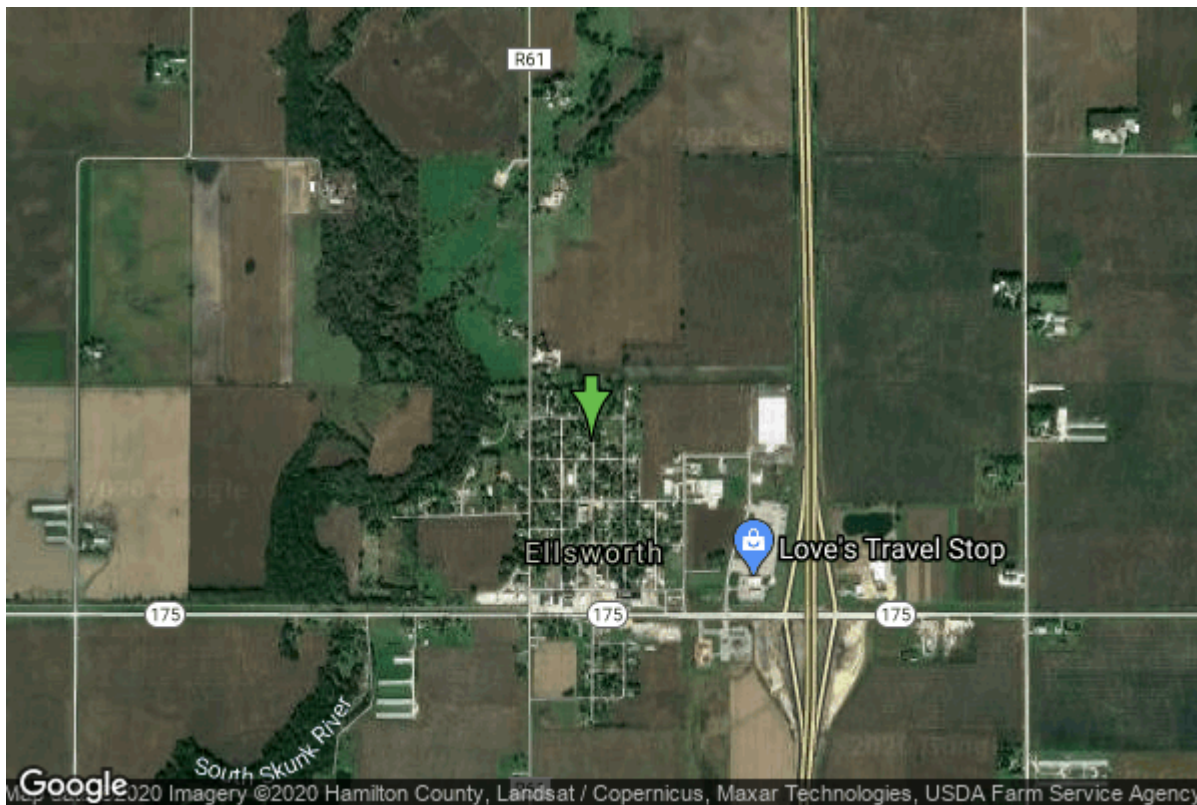

<b>Date Received</b>		<b>State</b>	Iowa
<b>Owner Name</b>	Ellsworth, City Of	<b>County</b>	Hamilton
<b>Alt Name</b>	#3	<b>Quadrangle</b>	Ellsworth, Iowa
<b>WNumber</b>	3492	<b>Township</b>	T87N
<b>PWTS ID</b>	0	<b>Range</b>	R23W
<b>PWS ID</b>	4009016	<b>Section</b>	30
<b>Storet ID</b>	0	<b>Quarter</b>	SW NW NE
<b>SDWIS ID</b>	2410701	<b>Latitude</b>	42.3159900000
<b>USGS ID</b>	0	<b>Longitude</b>	-93.5781900000
<b>Project</b>	Source Water Protection	<b>Accuracy</b>	
<b>Operator</b>	Unknown	<b>UTM X</b>	452353
		<b>UTM Y</b>	4685023

<b>Site Type</b>	Drilled hole	<b>Drilling Company</b>	Layne Western - Ia.
<b>Well Status</b>	Active	<b>Drilling Date</b>	12/17/1948
<b>Field Located</b>	No	<b>Drilling Method</b>	Cable
<b>Elevation</b>	1087 ft	<b>Bedrock Depth</b>	120 ft
<b>Elevation Accuracy</b>	Digital Elevation Model Accurate to 5 ft	<b>Well Depth</b>	365 ft
<b>Landscape Position</b>	Level Surface	<b>Total Depth</b>	365 ft
		<b>Well Types</b>	Municipal, Public Supply
		<b>Aquifers</b>	Mississippian

## Casing Construction Information

<b>Date</b>	12/17/1948	<b>Casing Type</b>	Steel
<b>Start Depth</b>	-1.00 ft	<b>End Depth</b>	127.60 ft

<b>Diameter</b>	10.00 in	<b>Amount</b>	128.60 ft
<b>Comments</b>			

## Grout Construction Information

<b>Date</b>	12/17/1948		
<b>Grout Type</b>	Cement	<b>Grout Placement</b>	Unknown
<b>Start Depth</b>	0.00 ft	<b>End Depth</b>	10.00 ft
<b>Comments</b>			

## Pump Construction Information

<b>Date</b>	12/17/1948	<b>Pump Type</b>	Turbine
<b>Diameter</b>	0.00 in	<b>Rating</b>	0
<b>Depth Intake</b>	80.00 ft		
<b>Comments</b>			

## Log Information

<b>Date</b>	01/05/1949
<b>Log Types</b>	Strip log
<b>Prepared By</b>	Unknown
<b>Comments</b>	

---

<b>Date</b>	
<b>Log Types</b>	Drillers log
<b>Prepared By</b>	Ellsworth, City Of
<b>Comments</b>	

## Stratigraphy Information

<b>System</b>	Quaternary		
<b>Series</b>			
<b>Group</b>			
<b>Formation</b>			
<b>Member</b>			
<b>Submember</b>			
<b>Start Depth</b>	0.00 ft	<b>End Depth</b>	5.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Soil Or Fill	<b>Percent</b>	100
<b>Secondary Lithology</b>		<b>Percent</b>	
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Quaternary		
<b>Series</b>	Pleistocene Series		
<b>Group</b>			
<b>Formation</b>			
<b>Member</b>			
<b>Submember</b>			
<b>Start Depth</b>	5.00 ft	<b>End Depth</b>	120.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Till	<b>Percent</b>	100
<b>Secondary Lithology</b>		<b>Percent</b>	
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Mississippian (Subsystem Of Carboniferous System)		
<b>Series</b>			
<b>Group</b>			
<b>Formation</b>	St. Louis		
<b>Member</b>			
<b>Submember</b>			
<b>Start Depth</b>	120.00 ft	<b>End Depth</b>	131.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Limestone	<b>Percent</b>	100
<b>Secondary Lithology</b>		<b>Percent</b>	
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Mississippian (Subsystem Of Carboniferous System)		
<b>Series</b>			
<b>Group</b>	Augusta		
<b>Formation</b>	Burlington		
<b>Member</b>			
<b>Submember</b>			
<b>Start Depth</b>	131.00 ft	<b>End Depth</b>	145.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Dolomite	<b>Percent</b>	100
<b>Secondary Lithology</b>		<b>Percent</b>	
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Unknown		
<b>Series</b>			
<b>Group</b>			
<b>Formation</b>			
<b>Member</b>			
<b>Submember</b>			

<b>Start Depth</b>	145.00 ft	<b>End Depth</b>	235.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Limestone	<b>Percent</b>	100
<b>Secondary Lithology</b>		<b>Percent</b>	
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Mississippian (Subsystem Of Carboniferous System)		
<b>Series</b>			
<b>Group</b>	Sub-Augusta		
<b>Formation</b>	Gilmore City		
<b>Member</b>	Iowa Falls Dolomite		
<b>Submember</b>			
<b>Start Depth</b>	235.00 ft	<b>End Depth</b>	290.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Limestone	<b>Percent</b>	0
<b>Secondary Lithology</b>	Dolomite	<b>Percent</b>	0
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Mississippian (Subsystem Of Carboniferous System)		
<b>Series</b>			
<b>Group</b>	Sub-Augusta		
<b>Formation</b>	Maynes Creek		
<b>Member</b>	Eagle City		
<b>Submember</b>			
<b>Start Depth</b>	290.00 ft	<b>End Depth</b>	345.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Limestone	<b>Percent</b>	0
<b>Secondary Lithology</b>	Dolomite	<b>Percent</b>	0
<b>Tertiary Lithology</b>		<b>Percent</b>	
<b>Comments</b>			

---

<b>System</b>	Mississippian (Subsystem Of Carboniferous System)		
<b>Series</b>			
<b>Group</b>	Sub-Augusta		
<b>Formation</b>	Maynes Creek		
<b>Member</b>			
<b>Submember</b>			
<b>Start Depth</b>	345.00 ft	<b>End Depth</b>	365.00 ft
<b>Contact Accuracy</b>			
<b>Penetration</b>			
<b>Primary Lithology</b>	Limestone	<b>Percent</b>	0
<b>Secondary Lithology</b>	Chert/Chalcedony	<b>Percent</b>	0
<b>Tertiary Lithology</b>	Dolomite	<b>Percent</b>	0
<b>Comments</b>			

## Water Production Information

<b>Date</b>	12/17/1948	<b>Start Time</b>	
<b>Aquifer</b>	Unknown		
<b>Static Water Level</b>	22.00 ft	<b>Yield</b>	106 gallons per minute
<b>Pumping Water Level</b>	32 ft	<b>Yield Method</b>	Unknown
<b>Measurement</b>	Unknown	<b>Pump Test</b>	Yes
<b>Pump Method</b>	Unknown	<b>Duration</b>	0 mins
<b>Comments</b>			

## Chip Storage Information

<b>Date</b>		<b>Bin</b>	
<b>Storage</b>	CE4-3	<b>Number of Samples</b>	73
<b>Number of Boxes</b>	1	<b>Sample Gaps</b>	
<b>Sample Intervals</b>	5	<b>Sample Bottom</b>	365 ft
<b>Sample Top</b>	0 ft	<b>Washed Bottom</b>	365 ft
<b>Washed Top</b>	120 ft		
<b>Duplicate Storage</b>			
<b>Comments</b>			

<https://www.ihr.uiowa.edu/igs/geosam/well/3492/general-information>